

**ECR#: P17**

**Tracker #: 20**

**Status: Ratified**

**Title: Correct Gold Finger Tolerance**

**Release Date: March 13, 1998**

**Impact, Medium: Motherboard design change**

**Spec Version: NLX Motherboard Specification 1.2**

**Summary:**

Correct the gold finger tolerance values shown in three of the figures.


**Background:**

Modify Figures 3.9, 3.10, and 3.11. For details about the changes, see the notes below each figure provided in this ECR.

**Change Current Specification As Shown:**

Replace Figure 3.9, Figure 3.10, and Figure 3.11 with the drawings and notes included here.




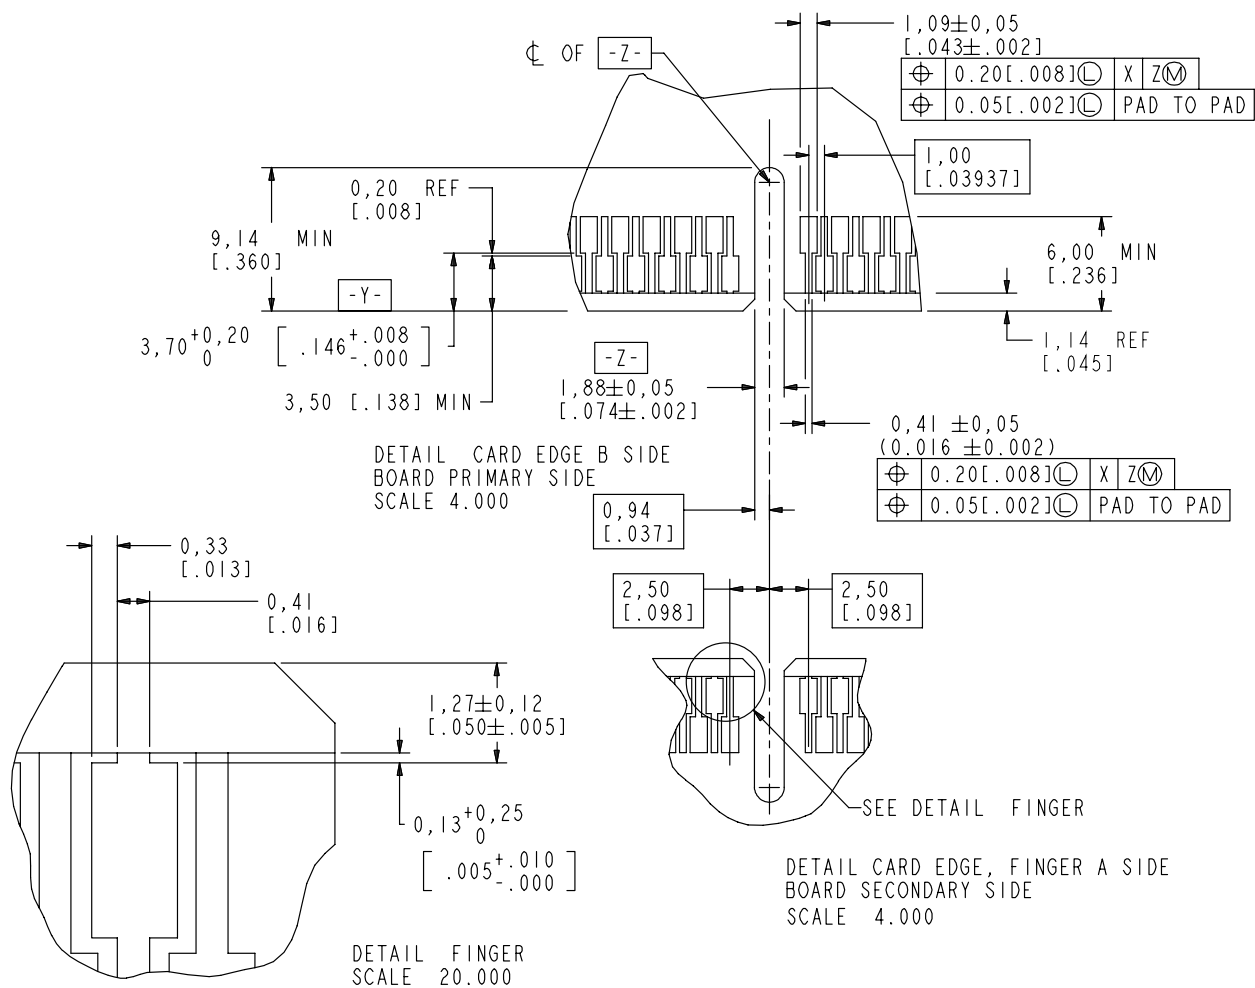

**Figure 3.10: NLX Card Edge Detail**

**Notes:**

1. Dimensioned with GDT (Geometric Dimensions and Tolerances) per ANSI Y14.5M.
2. See Figure 3.11 for pin location details.
3. Added detail view "Finger" with configuration to eliminate swipe while cutting chamfer.
4. Added key slot tolerance under Z.

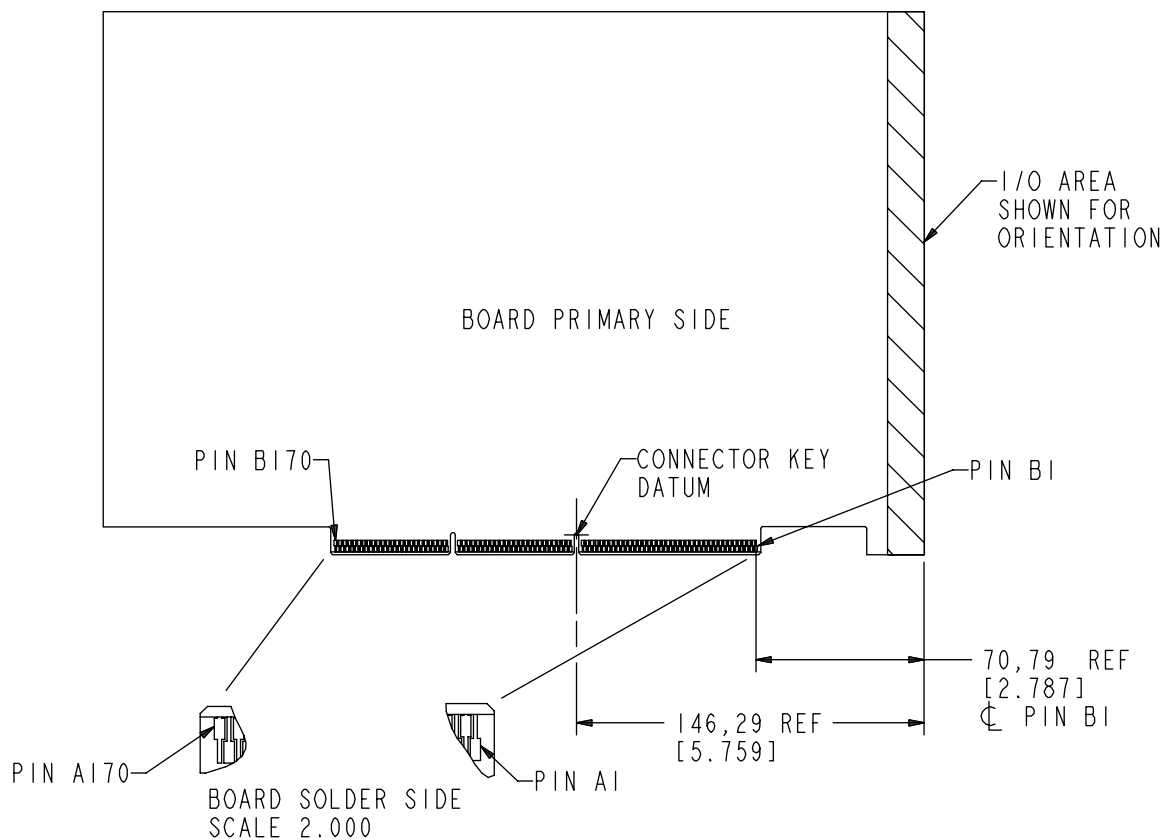

**Figure 3.11: NLX Card Edge, Board View**

Note:

1. Picture update shows chamfer.
2. Added pin number and location reference details.